

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start		Rating **	A	Issue No.	2
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_NA0003_01_s _ 2013_2				
Comment Code					
Inspector Comment					
The LMA has adequate flood fight supplies and equipment.					

No Photos

LM Start		Rating **	A	Issue No.	6
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_NA0003_01_s _ 2013_6				
Comment Code					
Inspector Comment					
The LMA completed flood fight training in 2016.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start		Rating **	A	Issue No.	10		
LM End		Issue Type +	Ma	Location *	N/A		
Category	Earthen Levee			GPS Latitude/Longitude			
				Start		End	
Item	Flood Preparedness & Training				o		o
					o		o
DWR ID	DWR_NA0003_01_s_2013_10						
Comment Code							
Inspector Comment							
The LMA has the O&M manuals.							

No Photos

LM Start	0.25	Rating **	A/W	Issue No.	58
LM End	0.25	Issue Type +	Ma	Location *	N/A
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.729219 °	39.729219 °
				-121.933437 °	-121.933437 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:29705 DS_ID:19209 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: Looks cleaned recently. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 12.5 feet below crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014					

Photo 1 of 3 : UCIP_SP_2017_29705_54924.jpg



WS view: U typed concrete headwall, flapgate on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.25	Rating **	A/W	Issue No.	58 (cont)
LM End	0.25	Issue Type +	Ma	Location *	N/A
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.729219 °	39.729219 °
				-121.933437 °	-121.933437 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:29705
DS_ID:19209
EP_NO: N/A
Repair Type: No Action Needed
Crossing Status: Found
UCIP Comments: Looks cleaned recently.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 12.5 feet below crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 2/20/2014

LM Start	0.25	Rating **	A/W	Issue No.	58 (cont)
LM End	0.25	Issue Type +	Ma	Location *	N/A

Photo 2 of 3 : UCIP_SP_2017_29705_54923.jpg



LS view: U typed concrete headwall, CMP on levee slope.

Photo 3 of 3 : UCIP_SP_2017_29705_54922.jpg



LS view: inside view of CMP on levee slope. Looks clean and clear.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.00	Rating **	M	Issue No.	59
LM End	1.00	Issue Type +	Ma	Location *	N/A
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.739268 °	39.739268 °
				-121.931891 °	-121.931891 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32044 DS_ID:19211 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Vegetation debris on waterside. Needs clearing and cleaning. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 12.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014					

LM Start	1.00	Rating **	M	Issue No.	59 (cont)
LM End	1.00	Issue Type +	Ma	Location *	N/A

Photo 1 of 3 : UCIP_SP_2017_32044_58543.jpg



WS view: U typed concrete headwall, pipe, and flapgate on levee slope.

Photo 2 of 3 : UCIP_SP_2017_32044_58542.jpg



WS view: vegetation debris blocking outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.90	Rating **	A/W	Issue No.	60
LM End	1.90	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.747563 °	39.747563 °
				-121.920170 °	-121.920170 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:50142
DS_ID:19212
EP_NO: N/A
Repair Type: No Action Needed
Crossing Status: Found
UCIP Comments: 08/29/2016: Shawn Bates of NA0003 has cleared the LS and WS of debris and blockage; WS gate functions properly now. Crossing has been downgraded from Urgent to No Action Needed. (K. Fazel - UCIP)08/11/2016: Same as last inspection. (K. Fazel - UCIP)02/20/2014: No riprap spillway on waterside. Needs cleaning and clearing of debris. Flap gate was not fully closed. (P. Amatya - UCIP)
FIELD_STRUCT_DESC: 24-inch corrugated metal pipe through the levee, 13 feet below the crown. Flap gate on the waterside (WS) end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landside (LS) end. Grouted riprap spillway on the WS end. [Additional Reference(s): DWR Levee Log, 2005. USACE Sacramento O&M Manual 504, May 1965 (HLM 1.95)].
FS Date: 8/11/2016

LM Start	1.90	Rating **	A/W	Issue No.	60 (cont)
LM End	1.90	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_50142_55886.jpg



WS view: U type concrete headwall, flapgate on levee slope. Gate was not fully closed.

Photo 2 of 3 : UCIP_SP_2017_50142_55885.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris blocking inlet.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.90	Rating **	A/W	Issue No.	60 (cont)
LM End	1.90	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.747563 °	39.747563 °
				-121.920170 °	-121.920170 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:50142
DS_ID:19212
EP_NO: N/A
Repair Type: No Action Needed
Crossing Status: Found
UCIP Comments: 08/29/2016: Shawn Bates of NA0003 has cleared the LS and WS of debris and blockage; WS gate functions properly now. Crossing has been downgraded from Urgent to No Action Needed. (K. Fazel - UCIP)08/11/2016: Same as last inspection. (K. Fazel - UCIP)02/20/2014: No riprap spillway on waterside. Needs cleaning and clearing of debris. Flap gate was not fully closed. (P. Amatya - UCIP)
FIELD_STRUCT_DESC: 24-inch corrugated metal pipe through the levee, 13 feet below the crown. Flap gate on the waterside (WS) end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landside (LS) end. Grouted riprap spillway on the WS end. [Additional Reference(s): DWR Levee Log, 2005. USACE Sacramento O&M Manual 504, May 1965 (HLM 1.95)].
FS Date: 8/11/2016

Photo 3 of 3 : UCIP_SP_2017_50142_55884.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

LM Start	3.03	Rating **	M	Issue No.	62
LM End	3.03	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.761224 °	39.761224 °
				-121.911108 °	-121.911108 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:30294
DS_ID:19216
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Inlet and outlet needs cleaning and clearing of debris.
FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 8.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 2/20/2014

Photo 1 of 2 : UCIP_SP_2017_30294_55704.jpg



WS view: U type concrete headwall, flapgate on levee slope.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.03	Rating **	M	Issue No.	62 (cont)
LM End	3.03	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.761224 °	39.761224 °
				-121.911108 °	-121.911108 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30294 DS_ID:19216 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Inlet and outlet needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 8.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014					

Photo 2 of 2 : UCIP_SP_2017_30294_55703.jpg



LS view: U type concrete headwall and CMP on levee slope. Debris blocking the inlet pipe.

LM Start	3.18	Rating **	M	Issue No.	63
LM End	3.18	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.763067 °	39.763067 °
				-121.909608 °	-121.909608 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30295					
DS_ID:19217					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: It needs cleaning and clearing in inlet and outlet ends.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/20/2014					

Photo 1 of 2 : UCIP_SP_2017_30295_55706.jpg



WS view: U type concrete headwall, flapgate on levee slope. Vegetation debris blocking the outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.18	Rating **	M	Issue No.	63 (cont)	
LM End	3.18	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.763067 °	39.763067 °	
				-121.909608 °	-121.909608 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30295						
DS_ID:19217						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: It needs cleaning and clearing in inlet and outlet ends.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end.						
Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/20/2014						

Photo 2 of 2 : UCIP_SP_2017_30295_55705.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris blocking the inlet.

LM Start	3.39	Rating **	M	Issue No.	64
LM End	3.39	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.765440 °	39.765440 °
				-121.907261 °	-121.907261 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30310 DS_ID:19218 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014					

Photo 1 of 3 : UCIP_SP_2017_30310_55741.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Vegetation debris blocking outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.39	Rating **	M	Issue No.	64 (cont)	
LM End	3.39	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.765440 °	39.765440 °	
				-121.907261 °	-121.907261 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30310						
DS_ID:19218						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/20/2014						

LM Start	3.39	Rating **	M	Issue No.	64 (cont)
LM End	3.39	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_30310_55740.jpg



LS view: U type concrete headwall and CMP on levee slope.

Photo 3 of 3 : UCIP_SP_2017_30310_55739.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.97	Rating **	M	Issue No.	65
LM End	3.97	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.771293 °	39.771293 °
				-121.900247 °	-121.900247 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30311 DS_ID:19219 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing of debris in both ends of the pipe. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014					

LM Start	3.97	Rating **	M	Issue No.	65 (cont)
LM End	3.97	Issue Type +	Ma	Location *	LS

Photo 1 of 2 : UCIP_SP_2017_30311_55743.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Vegetation debris blocking outlet.

Photo 2 of 2 : UCIP_SP_2017_30311_55742.jpg



LS view: U type concrete headwall and CMP on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.03	Rating **	M	Issue No.	51
LM End	4.03	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.771877 °	39.771877 °
				-121.899441 °	-121.899441 °
DWR ID	DWR_NA0003_01_f_2016_51				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_64_51_20170315_00030.jpg



View of the rodent holes along the landside slope.

LM Start	4.26	Rating **	M	Issue No.	5
LM End	4.32	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2015 USACE Erosion Survey, DRAFT			39.773257 °	39.773969 °
				-121.895618 °	-121.895078 °
DWR ID	DWR_NA0003_01_s_2016_5				
Comment Code					
Inspector Comment					
2011 - Two large erosion scallops at the toe from a rotational failure. Deep cracks along the slope indicate the potential for further failures. 2015: Site is part of the extended inventory, last inspected 2011. [2015 Site ID: MUD_4-4_R]					

No Photos

LM Start	4.27	Rating **	M	Issue No.	33
LM End	4.27	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.773398 °	39.773398 °
				-121.895765 °	-121.895765 °
DWR ID	DWR_NA0003_01_f_2015_33				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					
Repair the rodent holes along the landside slope.					

Photo 1 of 1 : SP_2017_NA0003_64_33_20170315_00016.jpg



View of the rodent holes along the landside slope.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.45	Rating **	M	Issue No.	53
LM End	4.45	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.775789 °	39.775789 °
				-121.894048 °	-121.894048 °
DWR ID	DWR_NA0003_01_f_2016_53				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_64_53_20170315_00032.jpg



View of the trees along the landside toe.

LM Start	4.46	Rating **	M	Issue No.	66
LM End	4.46	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775905 °	39.775905 °
				-121.893980 °	-121.893980 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30312					
DS_ID:19220					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 13.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/20/2014					

Photo 1 of 2 : UCIP_SP_2017_30312_55745.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Vegetation debris blocking outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.46	Rating **	M	Issue No.	66 (cont)	
LM End	4.46	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.775905 °		39.775905 °
				-121.893980 °		-121.893980 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30312						
DS_ID:19220						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 13.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/20/2014						

Photo 2 of 2 : UCIP_SP_2017_30312_55744.jpg



LS view: U type concrete headwall and CMP on levee slope. Needs cleaning and clearing of debris.

LM Start	4.81	Rating **	M	Issue No.	67
LM End	4.81	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.780244 °	39.780244 °
				-121.891267 °	-121.891267 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30388					
DS_ID:19221					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: CM Standpipe intake. Intake pipe with air vent. Steel rib-bar grit cover on the standpipe on landside levee toe.Needs cleaning and clearing on both ends of the pipe.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 15.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on waterside ends. Grouted riprap spillway on the waterward end. CM Standpipe intake. Intake pipe with air vent. Steel rib-bar grit cover on the standpipe on landside levee toe. O&M Manual Sac 504, May 1965.					
FS Date: 2/20/2014					

Photo 1 of 2 : UCIP_SP_2017_30388_55891.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Vegetation/soil debris blocking outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**


Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.81	Rating **	M	Issue No.	67 (cont)	
LM End	4.81	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.780244 °	39.780244 °	
				-121.891267 °	-121.891267 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30388 DS_ID:19221 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: CM Standpipe intake. Intake pipe with air vent. Steel rib-bar grit cover on the standpipe on landside levee toe.Needs cleaning and clearing on both ends of the pipe. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 15.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on waterside ends. Grouted riprap spillway on the waterward end. CM Standpipe intake. Intake pipe with air vent. Steel rib-bar grit cover on the standpipe on landside levee toe. O&M Manual Sac 504, May 1965. FS Date: 2/20/2014						

Photo 2 of 2 : UCIP_SP_2017_30388_55890.jpg

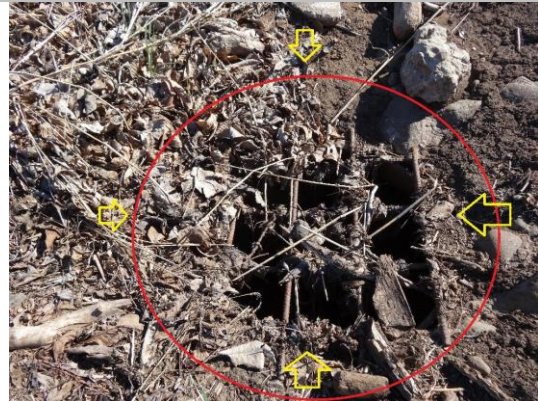

LS view: Underground CM standpipe intake with steel grit on levee toe.

LM Start	5.09	Rating **	A/W	Issue No.	69
LM End	5.09	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.783636 °	39.783636 °
				-121.888463 °	-121.888463 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30327					
DS_ID:19222					
EP_NO: N/A					
Repair Type: No Action Needed					
Crossing Status: Found					
UCIP Comments: Slide gate in CM stadpipe on waterside levee slope.					
FIELD_STRUCT_DESC: 36-inch CM pipe through the levee, 17.0 feet below the crown. Slide gate in CM standpipe on waterside levee slope.					
Flap gate on the waterward end. Concrete "U" headwalls on both ends.					
Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/20/2014					

Photo 1 of 3 : UCIP_SP_2017_30327_55768.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	5.09	Rating **	A/W	Issue No.	69 (cont)	
LM End	5.09	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.783636 °	39.783636 °	
				-121.888463 °	-121.888463 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30327						
DS_ID:19222						
EP_NO: N/A						
Repair Type: No Action Needed						
Crossing Status: Found						
UCIP Comments: Slide gate in CM stadpipe on waterside levee slope.						
FIELD_STRUCT_DESC: 36-inch CM pipe through the levee, 17.0 feet						
below the crown. Slide gate in CM standpipe on waterside levee slope.						
Flap gate on the waterward end. Concrete "U" headwalls on both ends.						
Grouted riprap apron on the landward end. Grouted riprap spillway on						
the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/20/2014						

Photo 2 of 3 : UCIP_SP_2017_30327_55767.jpg



WS view: CM standpipe with slide gate on levee slope.

LM Start	5.09	Rating **	A/W	Issue No.	69 (cont)
LM End	5.09	Issue Type +	Ma	Location *	LS

Photo 3 of 3 : UCIP_SP_2017_30327_55766.jpg



LS view: U type concrete headwall and CMP on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Mud Creek	Right	6.80	04/20/2017 04/20/2017	Bob Duffey

LM Start	6.08	Rating **	M	Issue No.	36
LM End	6.08	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.794708 °	39.794708 °
				-121.886616 °	-121.886616 °
DWR ID	DWR_NA0003_01_s _ 2016_36				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Blackberry bramble					

No Photos

LM Start	6.16	Rating **	M	Issue No.	34
LM End	6.16	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.795428 °	39.795428 °
				-121.885306 °	-121.885306 °
DWR ID	DWR_NA0003_01_s _ 2016_34				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Blackberry bramble on landside toe blocking visibility.					

Photo 1 of 1 : SP_2017_NA0003_64_34_20170315_00017.jpg



Trim vegetation at L/S toe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.23	Rating **	M	Issue No.	41
LM End	0.23	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.797416 °	39.797416 °
				-121.881675 °	-121.881675 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31667 DS_ID:19234 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.6 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 3/11/2014					

Photo 1 of 3 : UCIP_SP_2017_31667_57968.jpg



WS view: CMP culvert with U type concrete headwall. Vegetation debris blocking outlet box.

LM Start	0.23	Rating **	M	Issue No.	41 (cont)
LM End	0.23	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31667_57967.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Vegetation debris on outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.23	Rating **	M	Issue No.	41 (cont)	
LM End	0.23	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.797416 °	39.797416 °	
				-121.881675 °	-121.881675 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31667 DS_ID:19234 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.6 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 3/11/2014						

Photo 3 of 3 : UCIP_SP_2017_31667_57966.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris on inlet box.

LM Start	0.31	Rating **	M	Issue No.	29
LM End	0.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.797071 °	39.797071 °
				-121.883049 °	-121.883049 °
DWR ID	DWR_NA0003_02_f_2016_29				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_65_29_20170315_00007.jpg



View of the slope instability caused by vehicles along the landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.26	Rating **	M	Issue No.	42
LM End	1.26	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.784062 °	39.784062 °
				-121.884344 °	-121.884344 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30403 DS_ID:19235 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 12.5 below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/24/2014					

Photo 1 of 3 : UCIP_SP_2017_30403_55922.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.

LM Start	1.26	Rating **	M	Issue No.	42 (cont)
LM End	1.26	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_30403_55921.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris in inlet pipe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.26	Rating **	M	Issue No.	42 (cont)
LM End	1.26	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.784062 °	39.784062 °
				-121.884344 °	-121.884344 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30403					
DS_ID:19235					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 12.5 below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/24/2014					

Photo 3 of 3 : UCIP_SP_2017_30403_55920.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

LM Start	1.46	Rating **	M	Issue No.	43
LM End	1.46	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.782980 °	39.782980 °
				-121.887834 °	-121.887834 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30743					
DS_ID:19237					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/24/2014					

Photo 1 of 2 : UCIP_SP_2017_30743_56641.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Debris in outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.46	Rating **	M	Issue No.	43 (cont)	
LM End	1.46	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.782980 °	39.782980 °	
				-121.887834 °	-121.887834 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30743						
DS_ID:19237						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/24/2014						

Photo 2 of 2 : UCIP_SP_2017_30743_56640.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and soil in inlet area.

LM Start	1.54	Rating **	M	Issue No.	31
LM End	1.74	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.782175 °	39.779667 °
				-121.888813 °	-121.890613 °
DWR ID	DWR_NA0003_02_f_2016_31				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_65_31_20170315_00009.jpg



View of the trees along the landside toe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.62	Rating **	N	Issue No.	32
LM End	1.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.781173 °	39.781173 °
				-121.889526 °	-121.889526 °
DWR ID	DWR_NA0003_02_f_2016_32				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

LM Start	2.34	Rating **	M	Issue No.	46
LM End	2.34	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.772185 °	39.772185 °
				-121.895681 °	-121.895681 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30763 DS_ID:19239 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Debris in landside inlet area. Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/24/2014					

Photo 1 of 3 : UCIP_SP_2017_30763_56662.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Vegetation debris blocking outlet.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.34	Rating **	M	Issue No.	46 (cont)	
LM End	2.34	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.772185 °		39.772185 °
				-121.895681 °		-121.895681 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30763 DS_ID:19239 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Debris in landside inlet area. Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/24/2014						

LM Start	2.34	Rating **	M	Issue No.	46 (cont)
LM End	2.34	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_30763_56661.jpg



LS view: U type concrete headwall and CMP on levee slope.

Photo 3 of 3 : UCIP_SP_2017_30763_56660.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.74	Rating **	M	Issue No.	47
LM End	2.74	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.768741 °	39.768741 °
				-121.901176 °	-121.901176 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:30783					
DS_ID:19240					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/24/2014					

LM Start	2.74	Rating **	M	Issue No.	47 (cont)
LM End	2.74	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_30783_56682.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Gate not fully closed. Debris and soil in outlet box.

Photo 2 of 3 : UCIP_SP_2017_30783_56681.jpg



LS view: U type concrete headwall and CMP on levee slope. Debris and soil in inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	--	---	---

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.74	Rating **	M	Issue No.	47 (cont)	
LM End	2.74	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.768741 °	39.768741 °	
				-121.901176 °	-121.901176 °	
DWR ID						
Comment Code						
Inspector Comment						
<p>FS_ID:30783</p> <p>DS_ID:19240</p> <p>EP_NO: N/A</p> <p>Repair Type: Non-Urgent</p> <p>Crossing Status: Found</p> <p>UCIP Comments: Needs cleaning and clearing of debris.</p> <p>FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.</p> <p>FS Date: 2/24/2014</p>						

LM Start	3.50	Rating **	M	Issue No.	48					
LM End	3.50	Issue Type +	Ma	Location *	LS					
Category	Supplemental			GPS Latitude/Longitude						
				Start	End					
Item	DWR UCIP LMA Responsibility			39.760847 °	39.760847 °					
				-121.910265 °	-121.910265 °					
DWR ID										
Comment Code										
Inspector Comment										
FS_ID:30803 DS_ID:19241 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/24/2014										

A large, rusted metal barrel lies on its side in a corner, heavily overgrown with a dense mass of dry, tangled branches and twigs. The barrel is positioned against a concrete wall and floor, with a small pile of stones visible behind it. The branches are dry and brittle, creating a complex web that obscures much of the barrel's surface. The scene is illuminated by bright sunlight, casting sharp shadows.

* Location	** Rating	+ Issue Type
LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.50	Rating **	M	Issue No.	48 (cont)	
LM End	3.50	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.760847 °	39.760847 °	
				-121.910265 °	-121.910265 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:30803						
DS_ID:19241						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/24/2014						

LM Start	3.50	Rating **	M	Issue No.	48 (cont)
LM End	3.50	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_30803_56684.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and soil blocking inlet.

Photo 3 of 3 : UCIP_SP_2017_30803_56683.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.52	Rating **	M	Issue No.	10
LM End	3.52	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.760582 °	39.760582 °
				-121.910303 °	-121.910303 °
DWR ID	DWR_NA0003_02_f_2015_10				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_65_10_20170315_00006.jpg



View of the vehicle erosion along the landside slope.

LM Start	4.42	Rating **	M	Issue No.	11
LM End	4.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.751120 °	39.751120 °
				-121.915977 °	-121.915977 °
DWR ID	DWR_NA0003_02_f_2015_11				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	4.55	Rating **	A/W	Issue No.	8
LM End	4.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.749639 °	39.749639 °
				-121.917188 °	-121.917188 °
DWR ID	DWR_NA0003_02_f_2013_8				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					
Butte County has been grouting the rodent holes.					

Photo 1 of 2 : SP_2017_NA0003_65_8_20170315_00004.jpg



View of the bait station placed by the rodent hole.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.55	Rating **	A/W	Issue No.	8 (cont)	
LM End	4.55	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Animal Control			39.749639 °		39.749639 °
				-121.917188 °		-121.917188 °
DWR ID	DWR_NA0003_02_f_2013_8					
Comment Code						
A1 : Exterminate rodents and backfill and compact or grout burrows.						
Inspector Comment						
Butte County has been grouting the rodent holes.						

Photo 2 of 2 : SP_2017_NA0003_65_8_20170315_00005.jpg



View of the bait station by the rodent holes.

LM Start	4.61	Rating **	M	Issue No.	49
LM End	4.61	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.748731 °	39.748731 °
				-121.917577 °	-121.917577 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31028 DS_ID:19245 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/25/2014					

Photo 1 of 3 : UCIP_SP_2017_31028_56913.jpg


 WS view: U type concrete headwall, pipe, and flapgate on levee slope.
 Soil/mud on outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	4.61	Rating **	M	Issue No.	49 (cont)	
LM End	4.61	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.748731 °	39.748731 °	
				-121.917577 °	-121.917577 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31028						
DS_ID:19245						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/25/2014						

LM Start	4.61	Rating **	M	Issue No.	49 (cont)
LM End	4.61	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31028_56912.jpg



LS view: U type concrete headwall and CMP on levee slope.

Photo 3 of 3 : UCIP_SP_2017_31028_56911.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	5.56	Rating **	A	Issue No.	28
LM End	5.56	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.739085 °	39.739085 °
				-121.928878 °	-121.928878 °
DWR ID	DWR_NA0003_02_s_2017_28				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_65_28_20170426_00025.jpg



View of no vegetation on both slopes.

LM Start	5.64	Rating **	M	Issue No.	50
LM End	5.64	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.738898 °	39.738898 °
				-121.930242 °	-121.930242 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31031					
DS_ID:19247					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

Photo 1 of 3 : UCIP_SP_2017_31031_56917.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Soil/mud on outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	5.64	Rating **	M	Issue No.	50 (cont)	
LM End	5.64	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.738898 °	39.738898 °	
				-121.930242 °	-121.930242 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31031						
DS_ID:19247						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/25/2014						

LM Start	5.64	Rating **	M	Issue No.	50 (cont)
LM End	5.64	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31031_56916.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

Photo 3 of 3 : UCIP_SP_2017_31031_56915.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	6.09	Rating **	M	Issue No.	52 (cont)
LM End	6.09	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.733280 °	39.733280 °
				-121.930409 °	-121.930409 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:41377					
DS_ID:19259					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 2 of 2: Two 42-inch CM pipes through the					
levee, 16.0 feet below the crown. Flap gates on the waterward end.					
Slide gates in CM pipe riser on the waterward slope. Concrete "U"					
headwalls on both ends. Grouted riprap apron and rock revetment on					
the landward end. Channel Slough drainage structure. O&M Manual					
Sac 504, May 1965.					
FS Date: 2/25/2014					

Photo 3 of 3 : UCIP_SP_2017_41377_56921.jpg



LS view: U type concrete headwall and CMPs on levee slope. Soil/mud on inlet box.

LM Start	6.15	Rating **	M	Issue No.	53
LM End	6.15	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.732515 °	39.732515 °
				-121.930373 °	-121.930373 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31034					
DS_ID:19249					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 12.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

Photo 1 of 3 : UCIP_SP_2017_31034_56926.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	6.15	Rating **	M	Issue No.	53 (cont)
LM End	6.15	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.732515 °	39.732515 °
				-121.930373 °	-121.930373 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31034					
DS_ID:19249					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 12.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

LM Start	6.15	Rating **	M	Issue No.	53 (cont)
LM End	6.15	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31034_56925.jpg



LS view: U type concrete headwall and CMP on levee slope.

Photo 3 of 3 : UCIP_SP_2017_31034_56924.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	6.43	Rating **	M	Issue No.	54
LM End	6.43	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.728812 °	39.728812 °
				-121.932623 °	-121.932623 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31085					
DS_ID:19251					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing of debris.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 15.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

LM Start	6.43	Rating **	M	Issue No.	54 (cont)
LM End	6.43	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_31085_56988.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Soil/mud on outlet box.

Photo 2 of 3 : UCIP_SP_2017_31085_56987.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	6.94	Rating **	M	Issue No.	55 (cont)	
LM End	6.94	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.722798 °	39.722798 °	
				-121.937828 °	-121.937828 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31103						
DS_ID:19252						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing of debris.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 15.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 2/25/2014						

Photo 2 of 3 : UCIP_SP_2017_31103_57001.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

LM Start	6.94	Rating **	M	Issue No.	55 (cont)
LM End	6.94	Issue Type +	Ma	Location *	LS

Photo 3 of 3 : UCIP_SP_2017_31103_57000.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	7.17	Rating **	M	Issue No.	40
LM End	7.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.719593 °	39.718933 °
				-121.938137 °	-121.937635 °
DWR ID	DWR_NA0003_02_f_2016_40				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_65_40_20170315_00017.jpg



View of the dense vegetation along the landside toe blocking visibility and access.

LM Start	7.22	Rating **	M	Issue No.	56
LM End	7.22	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.718882 °	39.718882 °
				-121.937602 °	-121.937602 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32085 DS_ID:19253 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Slide gates in CMP risers on waterside shoulder.Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 1 of 3: Three 48-inch CM pipes through levee, 18.0 feet below crown. Flap gate on the waterward end. Slide gate in CMP riser on waterside shoulder. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/25/2014					

Photo 1 of 3 : UCIP_SP_2017_32085_58585.jpg



WS view: slide gates in CMP risers on waterside shoulder.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	7.22	Rating **	M	Issue No.	56 (cont)	
LM End	7.22	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.718882 °		39.718882 °
				-121.937602 °		-121.937602 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:32085 DS_ID:19253 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Slide gates in CMP risers on waterside shoulder.Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 1 of 3: Three 48-inch CM pipes through levee, 18.0 feet below crown. Flap gate on the waterward end. Slide gate in CMP riser on waterside shoulder. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/25/2014						

LM Start	7.22	Rating **	M	Issue No.	56 (cont)
LM End	7.22	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32085_58584.jpg



WS view: U type concrete headwall, pipes, and flapgates on levee slope. Soil/mud on outlet box. Vegetation debris blocking outlet box

Photo 3 of 3 : UCIP_SP_2017_32085_58586.jpg



LS view: U type concrete headwall and CMPs on levee slope. Soil/mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	7.23	Rating **	M	Issue No.	57 (cont)
LM End	7.23	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.718849 °	39.718849 °
				-121.937580 °	-121.937580 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32087					
DS_ID:19261					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Slide gates in CMP risers on waterside shoulder. Needs cleaning and clearing on both pipe ends.					
FIELD_STRUCT_DESC: 3 of 3: Three 48-inch CM pipes through levee, 18.0 feet below crown Flap gate on the waterward end. Slide gate in CMP riser on waterside shoulder. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

Photo 3 of 3 : UCIP_SP_2017_32087_58590.jpg



LS view: U type concrete headwall and CMPs on levee slope. Soil/mud on inlet box.

LM Start	7.23	Rating **	M	Issue No.	58
LM End	7.23	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.718862 °	39.718862 °
				-121.937594 °	-121.937594 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32086 DS_ID:19260 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Slide gates in CMP risers on waterside shoulder.Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 2 of 3: Three 48-inch CM pipes through levee, 18.0 feet below crown Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/25/2014					

Photo 1 of 3 : UCIP_SP_2017_32086_58589.jpg



WS view: slide gates in CMP risers on waterside shoulder.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	7.23	Rating **	M	Issue No.	58 (cont)
LM End	7.23	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.718862 °	39.718862 °
				-121.937594 °	-121.937594 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32086 DS_ID:19260 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Slide gates in CMP risers on waterside shoulder.Needs cleaning and clearing of debris. FIELD_STRUCT_DESC: 2 of 3: Three 48-inch CM pipes through levee, 18.0 feet below crown Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 2/25/2014					

LM Start	7.23	Rating **	M	Issue No.	58 (cont)
LM End	7.23	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32086_58588.jpg



WS view: U type concrete headwall, pipes, and flapgates on levee slope. Soil/mud on outlet box. Vegetation debris on outlet box

Photo 3 of 3 : UCIP_SP_2017_32086_58587.jpg



LS view: U type concrete headwall and CMPs on levee slope. Soil/mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017


Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Mud Creek	Left	7.96	04/20/2017 04/20/2017	Bob Duffey

LM Start	7.77	Rating **	M	Issue No.	59
LM End	7.77	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.711436 °	39.711436 °
				-121.937135 °	-121.937135 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31129					
DS_ID:19254					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Debris in inlet pipe, needs cleaning and clearing.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 18.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 2/25/2014					

LM Start	7.77	Rating **	M	Issue No.	59 (cont)
LM End	7.77	Issue Type +	Ma	Location *	LS

Photo 1 of 2 : UCIP_SP_2017_31129_57036.jpg

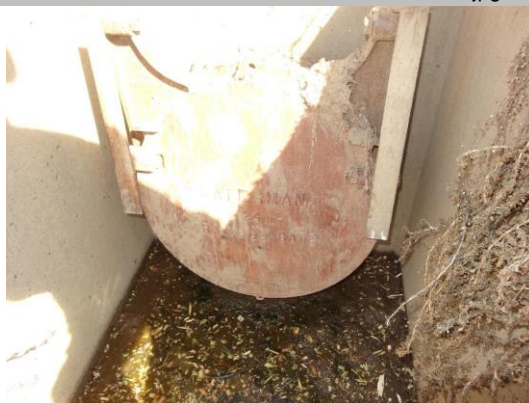

WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Soil/mud on outlet box.

Photo 2 of 2 : UCIP_SP_2017_31129_57035.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud and vegetation on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02A Channel Slough	Left	0.26	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.01	Rating **	A	Issue No.	3
LM End	0.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.733098 °	39.733098 °
				-121.930138 °	-121.930138 °
DWR ID	DWR_NA0003_02A_s_2017_3				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_66_3_20170426_00001.jpg



View of no vegetation on both slopes.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.02	Rating **	M	Issue No.	12
LM End	0.02	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.785970 °	39.785970 °
				-121.882797 °	-121.882797 °
DWR ID	DWR_NA0003_03_f_2015_12				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion on both slopes caused by motorcycle traffic.					

Photo 1 of 1 : SP_2017_NA0003_67_12_20170315_00002.jpg



View of the erosion on both slopes caused by motorcycle traffic.

LM Start	0.07	Rating **	M	Issue No.	3
LM End	0.07	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.786068 °	39.786068 °
				-121.881828 °	-121.881828 °
DWR ID	DWR_NA0003_03_s_2012_3				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion on landside slope caused by motorcycle traffic.					

Photo 1 of 1 : SP_2017_NA0003_67_3_20170315_00001.jpg



View of the erosion caused by motorcycles on the land side slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.10	Rating **	A/W	Issue No.	23
LM End	0.10	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.786195 °	39.786195 °
				-121.881325 °	-121.881325 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:51844
DS_ID:19262
EP_NO: N/A
Repair Type: No Action Needed
Crossing Status: Found
UCIP Comments: 05/16/2017 Crossing has been downgraded from Non-Urgent to No Action Needed. The flap gate appears to be in good working order based on the photos, and the small pile of debris not enough to warrant Non-Urgent rating. (K. Fazel - UCIP)03/11/2014:Slide gate in CMP riser on waterside.The culvert was working during field inspection. (P. Amatya - DWR)
FIELD_STRUCT_DESC: 42-inch CM pipe through the levee, 14 feet below the crown. Flap gate on the waterward end. Slid gate in CM riser on the waterward slope. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/11/2014

LM Start	0.10	Rating **	A/W	Issue No.	23 (cont)
LM End	0.10	Issue Type +	Ma	Location *	WS

Photo 1 of 3 : UCIP_SP_2017_51844_58602.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.

Photo 2 of 3 : UCIP_SP_2017_51844_58601.jpg



WS view: U type concrete headwall of CMP culvert on levee slope.
Grouted riprap levee slope and spillway.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.10	Rating **	A/W	Issue No.	23 (cont)	
LM End	0.10	Issue Type +	Ma	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.786195 °	39.786195 °	
				-121.881325 °	-121.881325 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51844						
DS_ID:19262						
EP_NO: N/A						
Repair Type: No Action Needed						
Crossing Status: Found						
UCIP Comments: 05/16/2017 Crossing has been downgraded from Non-Urgent to No Action Needed. The flap gate appears to be in good working order based on the photos, and the small pile of debris not enough to warrant Non-Urgent rating. (K. Fazel - UCIP)03/11/2014:Slide gate in CMP riser on waterside.The culvert was working during field inspection. (P. Amatya - DWR)						
FIELD_STRUCT_DESC: 42-inch CM pipe through the levee, 14 feet below the crown. Flap gate on the waterward end. Slid gate in CM riser on the waterward slope. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/11/2014						

Photo 3 of 3 : UCIP_SP_2017_51844_58600.jpg



WS view: slide gate in CMP riser on waterside shoulder.

LM Start	0.35	Rating **	M	Issue No.	15
LM End	0.35	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.785704 °	39.785704 °
				-121.877004 °	-121.877004 °
DWR ID	DWR_NA0003_03_f_2016_15				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_67_15_20170315_00004.jpg



View of the overgrown tree along the landside slope.

* Location
 LS : Land Side N/A : Not Applicable
 WS : Water Side
 CR : Crown

** Rating
 A : Acceptable N : Not Inspected/Rated
 M : Minimally Acceptable C : Corrected
 U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type
 Ma : Maintenance Deficiency
 Ob : Design & System Obsolescence
 En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.25	Rating **	A/W	Issue No.	27
LM End	1.25	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.779678 °	39.779678 °
				-121.862632 °	-121.862632 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:32107
DS_ID:19264
EP_NO: N/A
Repair Type: No Action Needed
Crossing Status: Found
UCIP Comments: The culvert was working during the field visit.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.7 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. O&M Manual Sac 504, May 1965.
FS Date: 3/11/2014

LM Start	1.25	Rating **	A/W	Issue No.	27 (cont)
LM End	1.25	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_32107_58613.jpg



WS view: U type concrete headwall and grouted riprap on levee slope.

Photo 2 of 3 : UCIP_SP_2017_32107_58612.jpg



WS view: U type concrete headwall, flapgate, and CMP on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.25	Rating **	A/W	Issue No.	27 (cont)
LM End	1.25	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.779678 °	39.779678 °
				-121.862632 °	-121.862632 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32107 DS_ID:19264 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: The culvert was working during the field visit. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.7 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. O&M Manual Sac 504, May 1965. FS Date: 3/11/2014					

Photo 3 of 3 : UCIP_SP_2017_32107_58611.jpg



LS view: U type concrete headwall and CMP on levee slope.

LM Start	1.35	Rating **	A	Issue No.	22
LM End	1.35	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.779442 °	39.779442 °
				-121.860913 °	-121.860913 °
DWR ID	DWR_NA0003_03_s_2017_22				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_67_22_20170426_00038.jpg



View of no vegetation on both slopes.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.50	Rating **	A/W	Issue No.	28
LM End	1.50	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.779230 °	39.779230 °
				-121.857945 °	-121.857945 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31899 DS_ID:19265 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: Working during the field visit. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. Grouted riprap apron on both ends. O&M Manual Sac 504, May 1965. FS Date: 3/11/2014					

Photo 1 of 2 : UCIP_SP_2017_31899_58187.jpg



WS view: U type concrete headwall, flapgate, and CMP on levee slope. Looks clean and clear.

LM Start	1.50	Rating **	A/W	Issue No.	28 (cont)
LM End	1.50	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : UCIP_SP_2017_31899_58186.jpg



LS view: U type concrete headwall and CMP on levee slope. Looks clean and clear.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.17	Rating **	M	Issue No.	30
LM End	2.17	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.785290 °	39.785290 °
				-121.844235 °	-121.844235 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32124					
DS_ID:19267					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Pipe is about 4 feet below the crown. Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on each end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_32124_58625.jpg



WS view: concrete headwall, pipe, and flapgate on levee slope.
Vegetation and mud on outlet box.

LM Start	2.17	Rating **	M	Issue No.	30 (cont)
LM End	2.17	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32124_58624.jpg



LS view: U type concrete headwall of CMP culvert on levee slope.
Vegetation on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.17	Rating **	M	Issue No.	30 (cont)
LM End	2.17	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.785290 °	39.785290 °
				-121.844235 °	-121.844235 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32124 DS_ID:19267 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Pipe is about 4 feet below the crown. Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 6.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on each end. O&M Manual Sac 504, May 1965. FS Date: 3/7/2014					

Photo 3 of 3 : UCIP_SP_2017_32124_58627.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

LM Start	3.08	Rating **	M	Issue No.	32
LM End	3.08	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.778016 °	39.778016 °
				-121.854460 °	-121.854460 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31901					
DS_ID:19269					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_31901_58194.jpg



WS view: U type concrete headwall, flapgate, and CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.08	Rating **	M	Issue No.	32 (cont)	
LM End	3.08	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.778016 °	39.778016 °	
				-121.854460 °	-121.854460 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31901						
DS_ID:19269						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

LM Start	3.08	Rating **	M	Issue No.	32 (cont)
LM End	3.08	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31901_58193.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

Photo 3 of 3 : UCIP_SP_2017_31901_58195.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.19	Rating **	A/W	Issue No.	33
LM End	3.19	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.777463 °	39.777463 °
				-121.852512 °	-121.852512 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31902					
DS_ID:19270					
EP_NO: N/A					
Repair Type: No Action Needed					
Crossing Status: Found					
UCIP Comments:					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_31902_58201.jpg



WS view: U type concrete headwall and grouted riprap spillway on levee slope.

LM Start	3.19	Rating **	A/W	Issue No.	33 (cont)
LM End	3.19	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31902_58200.jpg



WS view: U type concrete headwall and CMP on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.19	Rating **	A/W	Issue No.	33 (cont)	
LM End	3.19	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.777463 °		39.777463 °
				-121.852512 °		-121.852512 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31902						
DS_ID:19270						
EP_NO: N/A						
Repair Type: No Action Needed						
Crossing Status: Found						
UCIP Comments:						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet						
below the crown. Flap gate on the waterward end. Concrete "U"						
headwalls on both ends. Grouted riprap apron on the landward end.						
Grouted riprap spillway on the waterward end. O&M Manual Sac 504,						
May 1965.						
FS Date: 3/7/2014						

Photo 3 of 3 : UCIP_SP_2017_31902_58199.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

LM Start	3.34	Rating **	M	Issue No.	34
LM End	3.34	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.777410 °	39.777410 °
				-121.849627 °	-121.849627 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31864					
DS_ID:19271					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_31864_58069.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Soil/mud on outlet box. Vegetation debris blocking outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.34	Rating **	M	Issue No.	34 (cont)
LM End	3.34	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.777410 °	39.777410 °
				-121.849627 °	-121.849627 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:31864
DS_ID:19271
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Needs cleaning and clearing the culvert.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/7/2014

LM Start	3.34	Rating **	M	Issue No.	34 (cont)
LM End	3.34	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31864_58068.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

Photo 3 of 3 : UCIP_SP_2017_31864_58067.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.38	Rating **	M	Issue No.	14
LM End	3.38	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.777429 °	39.777429 °
				-121.848937 °	-121.848937 °
DWR ID	DWR_NA0003_03_f_2016_14				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_67_14_20170315_00003.jpg



View of a bush along the landside toe.

LM Start	3.50	Rating **	M	Issue No.	35
LM End	3.50	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.777139 °	39.777139 °
				-121.846769 °	-121.846769 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31856 DS_ID:19272 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_31856_58053.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope.
Soil/mud on outlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.50	Rating **	M	Issue No.	35 (cont)	
LM End	3.50	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.777139 °	39.777139 °	
				-121.846769 °	-121.846769 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31856						
DS_ID:19272						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

LM Start	3.50	Rating **	M	Issue No.	35 (cont)
LM End	3.50	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31856_58052.jpg



LS view: U type concrete headwall and CMP on levee slope. Soil/mud on inlet box.

Photo 3 of 3 : UCIP_SP_2017_31856_58051.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Sycamore and Sheep Hollow Creeks	Right	4.05	04/20/2017 04/20/2017	Bob Duffey

LM Start	3.68	Rating **	M	Issue No.	37
LM End	3.68	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.777662 °	39.777662 °
				-121.843489 °	-121.843489 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32125					
DS_ID:19275					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: The culvert was working during the field visit.Needs cleaning and clearing on both ends of the pipe.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 7.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/4/2014					

Photo 1 of 2 : UCIP_SP_2017_32125_58629.jpg



WS view: U type concrete headwall, pipe, and flapgate on levee slope. Soil/mud on outlet box. Vegetation debris blocking outlet box.

LM Start	3.68	Rating **	M	Issue No.	37 (cont)
LM End	3.68	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : UCIP_SP_2017_32125_58628.jpg



LS view: U type concrete headwall and pipe on levee slope. Soil/mud on inlet box. Vegetation debris blocking inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.16	Rating **	M	Issue No.	20
LM End	0.16	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.776526 °	39.776526 °
				-121.848727 °	-121.848727 °
DWR ID	DWR_NA0003_04_f_2016_20				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_68_20_20170315_00006.jpg



View of the vegetation along the landside toe blocking visibility.

LM Start	0.27	Rating **	M	Issue No.	25
LM End	0.27	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.776554 °	39.776554 °
				-121.850730 °	-121.850730 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32026					
DS_ID:19279					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_32026_58520.jpg



WS view: concrete headwall and grouted riprap spillway on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.27	Rating **	M	Issue No.	25 (cont)	
LM End	0.27	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.776554 °	39.776554 °	
				-121.850730 °	-121.850730 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:32026						
DS_ID:19279						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

LM Start	0.27	Rating **	M	Issue No.	25 (cont)
LM End	0.27	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32026_58519.jpg



WS view: U type concrete headwall and CMP on levee slope. Mud and vegetation debris on outlet box.

Photo 3 of 3 : UCIP_SP_2017_32026_58518.jpg



LS view: U type concrete headwall and CMP on levee slope. Mud and pebbles on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.33	Rating **	M	Issue No.	26
LM End	0.33	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775926 °	39.775926 °
				-121.850647 °	-121.850647 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32025					
DS_ID:19280					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Slide gate in a CMP riser. Vegetation debris and mud on inlet box.Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee and under the channel, 9.5 feet below the crown. Slide gate in CM pipe riser on the waterward slope. Concrete "U" headwall on the landward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

LM Start	0.33	Rating **	M	Issue No.	26 (cont)
LM End	0.33	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_32025_58512.jpg



WS view: slide gate in CMP riser on waterside shoulder.

Photo 2 of 3 : UCIP_SP_2017_32025_58511.jpg



WS view: inside view of slide gate in CMP riser on waterside shoulder.
Debris trapped in the riser.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.33	Rating **	M	Issue No.	26 (cont)	
LM End	0.33	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.775926 °	39.775926 °	
				-121.850647 °	-121.850647 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:32025 DS_ID:19280 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Slide gate in a CMP riser. Vegetation debris and mud on inlet box.Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee and under the channel, 9.5 feet below the crown. Slide gate in CM pipe riser on the waterward slope. Concrete "U" headwall on the landward end. O&M Manual Sac 504, May 1965. FS Date: 3/7/2014						

Photo 3 of 3 : UCIP_SP_2017_32025_58510.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud on inlet box.

LM Start	0.35	Rating **	M	Issue No.	27
LM End	0.35	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775682 °	39.775682 °
				-121.850375 °	-121.850375 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32023					
DS_ID:19281					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 8.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_32023_58505.jpg



WS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud on outlet box. Needs cleaning and clearing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.35	Rating **	M	Issue No.	27 (cont)
LM End	0.35	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775682 °	39.775682 °
				-121.850375 °	-121.850375 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:32023
DS_ID:19281
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Needs cleaning and clearing the culvert.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 8.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/7/2014

LM Start	0.35	Rating **	M	Issue No.	27 (cont)
LM End	0.35	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32023_58504.jpg



LS view: U type concrete headwall and CMP on levee slope. Pebbles and mud on inlet box.

Photo 3 of 3 : UCIP_SP_2017_32023_58503.jpg



LS view: inside view of the CM pipe. Needs cleaning and clearing the pipe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.35	Rating **	M	Issue No.	21
LM End	0.39	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.775672 °	39.775220 °
				-121.850301 °	-121.849805 °
DWR ID	DWR_NA0003_04_f_2016_21				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_68_21_20170315_00007.jpg



View of the overgrown trees along the landside toe.

LM Start	0.90	Rating **	M	Issue No.	22
LM End	0.90	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.775486 °	39.775486 °
				-121.850606 °	-121.850606 °
DWR ID	DWR_NA0003_04_f_2016_22				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_68_22_20170315_00008.jpg



View of the blackberries blocking visibility and access.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.92	Rating **	M	Issue No.	28
LM End	0.92	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775704 °	39.775704 °
				-121.850901 °	-121.850901 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:32143
DS_ID:19287
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Needs cleaning and clearing the culvert.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 9.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/7/2014

LM Start	0.92	Rating **	M	Issue No.	28 (cont)
LM End	0.92	Issue Type +	Ma	Location *	LS

Photo 1 of 2 : UCIP_SP_2017_32143_58641.jpg



WS view: U type concrete headwall and CMP on levee slope. Soil/mud on outlet box. Needs cleaning and clearing.

Photo 2 of 2 : UCIP_SP_2017_32143_58640.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation and mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.94	Rating **	M	Issue No.	30
LM End	0.94	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.775899 °	39.775899 °
				-121.851124 °	-121.851124 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:32144					
DS_ID:19288					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Slide gate in CMP riser on waterside. No access to CMP riser.Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee and under the channel, 9.5 feet below the crown. Slide gate in pipe riser on the waterward slope. Concrete "U" headwall on the landward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_32144_58644.jpg



LS view: U type concrete headwall of CMP culvert on levee slope. Vegetation debris and mud on inlet box.

LM Start	0.94	Rating **	M	Issue No.	30 (cont)
LM End	0.94	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_32144_58643.jpg



LS view: close view of vegetation debris and mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.94	Rating **	M	Issue No.	30 (cont)	
LM End	0.94	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.775899 °	39.775899 °	
				-121.851124 °	-121.851124 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:32144						
DS_ID:19288						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Slide gate in CMP riser on waterside. No access to CMP riser.Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee and under the channel, 9.5 feet below the crown. Slide gate in pipe riser on the waterward slope. Concrete "U" headwall on the landward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

Photo 3 of 3 : UCIP_SP_2017_32144_58642.jpg



WS view: slide gate in CMP riser on waterside. No access to CMP riser.

LM Start	1.04	Rating **	M	Issue No.	23
LM End	1.04	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.776589 °	39.776589 °
				-121.852600 °	-121.852600 °
DWR ID	DWR_NA0003_04_f_2016_23				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_68_23_20170315_00009.jpg



View of the blackberries blocking visibility and access.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.11	Rating **	M	Issue No.	31
LM End	1.11	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.776709 °	39.776709 °
				-121.853932 °	-121.853932 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:31963
DS_ID:19289
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Needs cleaning and clearing the culvert.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/7/2014

LM Start	1.11	Rating **	M	Issue No.	31 (cont)
LM End	1.11	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_31963_58384.jpg



WS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud on outlet box. Needs cleaning and clearing.

Photo 2 of 3 : UCIP_SP_2017_31963_58383.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud on inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.11	Rating **	M	Issue No.	31 (cont)
LM End	1.11	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.776709 °	39.776709 °
				-121.853932 °	-121.853932 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31963 DS_ID:19289 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Needs cleaning and clearing the culvert. FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965. FS Date: 3/7/2014					

Photo 3 of 3 : UCIP_SP_2017_31963_58385.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

LM Start	1.16	Rating **	M	Issue No.	17
LM End	1.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.777128 °	39.777580 °
				-121.854763 °	-121.855612 °
DWR ID	DWR_NA0003_04_f_2015_17				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Remove the trees that are overhanging the levee slope.					

Photo 1 of 1 : SP_2017_NA0003_68_17_20170315_00004.jpg



View of the trees overhanging the levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.35	Rating **	M	Issue No.	32
LM End	1.35	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.778370 °	39.778370 °
				-121.857904 °	-121.857904 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31964					
DS_ID:19290					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 13.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

LM Start	1.35	Rating **	M	Issue No.	32 (cont)
LM End	1.35	Issue Type +	Ma	Location *	LS

Photo 1 of 2 : UCIP_SP_2017_31964_58389.jpg



WS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud in outlet box. Needs cleaning and clearing.

Photo 2 of 2 : UCIP_SP_2017_31964_58388.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud in inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.56	Rating **	A	Issue No.	16
LM End	1.56	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.778610 °	39.778610 °
				-121.861735 °	-121.861735 °
DWR ID	DWR_NA0003_04_s_2017_16				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_68_16_20170426_00038.jpg



View of no vegetation on both slopes.

LM Start	2.04	Rating **	U	Issue No.	18
LM End	2.08	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.781669 °	39.782025 °
				-121.869804 °	-121.870252 °
DWR ID	DWR_NA0003_04_s_2016_18				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Trees and shrubbery obscure visibility on landside toe hinge point.					

Photo 1 of 1 : SP_2017_NA0003_68_18_20170315_00005.jpg



View of the vegetation on fence at landside toe.

* Location
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

** Rating
A : Acceptable
M : Minimally Acceptable
U : Unacceptable
N : Not Inspected/Rated
C : Corrected
A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.15	Rating **	M	Issue No.	33
LM End	2.15	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.782777 °	39.782777 °
				-121.871179 °	-121.871179 °
DWR ID					

Comment Code

Inspector Comment

FS_ID:31965
DS_ID:19291
EP_NO: N/A
Repair Type: Non-Urgent
Crossing Status: Found
UCIP Comments: Needs cleaning and clearing the culvert.
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.
FS Date: 3/7/2014

LM Start	2.15	Rating **	M	Issue No.	33 (cont)
LM End	2.15	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : UCIP_SP_2017_31965_58395.jpg



WS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud in outlet box. Needs cleaning and clearing.

Photo 2 of 3 : UCIP_SP_2017_31965_58394.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud in inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.15	Rating **	M	Issue No.	33 (cont)	
LM End	2.15	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.782777 °	39.782777 °	
				-121.871179 °	-121.871179 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31965						
DS_ID:19291						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through the levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

Photo 3 of 3 : UCIP_SP_2017_31965_58393.jpg



LS view: inside view of CMP on levee slope. Needs cleaning and clearing.

LM Start	2.47	Rating **	M	Issue No.	34
LM End	2.47	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.784244 °	39.784244 °
				-121.876810 °	-121.876810 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:31966					
DS_ID:19292					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Needs cleaning and clearing the culvert.					
FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.					
FS Date: 3/7/2014					

Photo 1 of 3 : UCIP_SP_2017_31966_58401.jpg



WS view: U type concrete headwall and grouted riprap spillway on levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Sycamore and Dry Creeks	Right	2.86	04/20/2017 04/20/2017	Bob Duffey

LM Start	2.47	Rating **	M	Issue No.	34 (cont)	
LM End	2.47	Issue Type +	Ma	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			39.784244 °	39.784244 °	
				-121.876810 °	-121.876810 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:31966						
DS_ID:19292						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Needs cleaning and clearing the culvert.						
FIELD_STRUCT_DESC: 24-inch CM pipe through levee, 11.0 feet below the crown. Flap gate on the waterward end. Concrete "U" headwalls on both ends. Grouted riprap apron on the landward end. Grouted riprap spillway on the waterward end. O&M Manual Sac 504, May 1965.						
FS Date: 3/7/2014						

LM Start	2.47	Rating **	M	Issue No.	34 (cont)
LM End	2.47	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_31966_58400.jpg



WS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud on outlet box. Needs cleaning and clearing.

Photo 3 of 3 : UCIP_SP_2017_31966_58399.jpg



LS view: U type concrete headwall and CMP on levee slope. Vegetation debris and mud in pipe and inlet box.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Big Chico Diversion	Left	1.85	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.21	Rating **	M	Issue No.	4
LM End	0.26	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.761957 °	39.761892 °
				-121.792867 °	-121.793705 °
DWR ID	DWR_NA0003_05_f_2014_4				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the vegetation from the waterside slope.					

Photo 1 of 1 : SP_2017_NA0003_69_4_20170315_00002.jpg



View of the vegetation along the waterside slope.

LM Start	0.33	Rating **	M	Issue No.	9
LM End	0.33	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.761642 °	39.761642 °
				-121.795008 °	-121.795008 °
DWR ID	DWR_NA0003_05_s_2017_9				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_69_9_20170426_00012.jpg



View of the vegetation along the waterside slope and toe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**


Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Big Chico Diversion	Left	1.85	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.34	Rating **	M	Issue No.	3
LM End	0.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.761633 °	39.761117 °
				-121.795155 °	-121.796464 °
DWR ID	DWR_NA0003_05_f_2013_3				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 2 : SP_2017_NA0003_69_3_20170426_00010.jpg

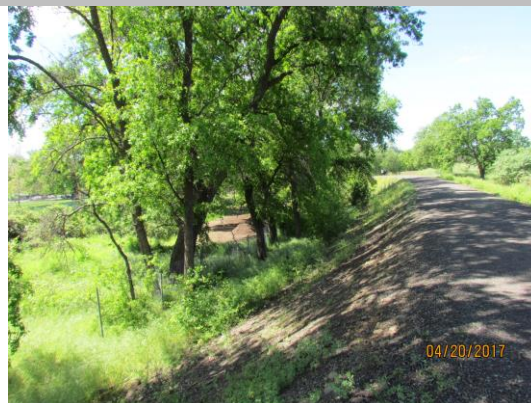

View of the vegetation along the landside slope and toe.

LM Start	0.34	Rating **	M	Issue No.	3 (cont)
LM End	0.42	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : SP_2017_NA0003_69_3_20170315_00001.jpg



View of the vegetation along the landside slope and toe.

LM Start	0.42	Rating **	M	Issue No.	11
LM End	0.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.761077 °	39.761077 °
				-121.796576 °	-121.796576 °
DWR ID	DWR_NA0003_05_f_2016_11				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_69_11_20170315_00005.jpg



View of the damaged slope by foot traffic.

*** Location**
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

**** Rating**
A : Acceptable N : Not Inspected/Rated
M : Minimally Acceptable C : Corrected
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Big Chico Diversion	Left	1.85	04/20/2017 04/20/2017	Bob Duffey

LM Start	0.50	Rating **	M	Issue No.	12
LM End	0.82	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.761836 °	39.763507 °
				-121.797316 °	-121.802545 °
DWR ID	DWR_NA0003_05_f_2016_12				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					


Photo 1 of 1 : SP_2017_NA0003_69_12_20170315_00006.jpg



View of the trees along the landside slope.

LM Start	0.84	Rating **	A	Issue No.	14
LM End	0.84	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.763700 °	39.763700 °
				-121.802752 °	-121.802752 °
DWR ID	DWR_NA0003_05_s_2017_14				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_69_14_20170426_00013.jpg

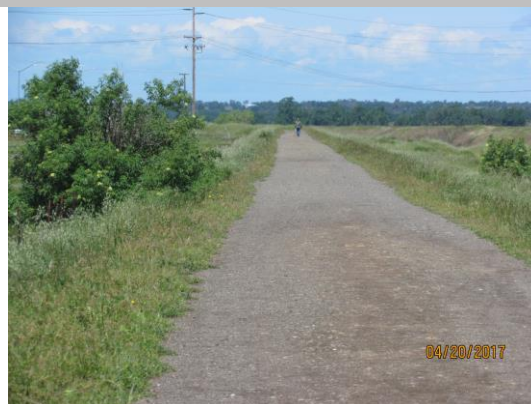

View of the native grasses on both slopes.

LM Start	0.89	Rating **	A/W	Issue No.	6
LM End	0.89	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.764397 °	39.764397 °
				-121.803335 °	-121.803335 °
DWR ID	DWR_NA0003_05_f_2014_6				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Elderberry is not completely blocking the visibility.					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Butte County Department of Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Big Chico Diversion	Left	1.85	04/20/2017 04/20/2017	Bob Duffey

LM Start	1.25	Rating **	M	Issue No.	13
LM End	1.25	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.768621 °	39.768621 °
				-121.807052 °	-121.807052 °
DWR ID	DWR_NA0003_05_f_2016_13				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2017_NA0003_69_13_20170315_00007.jpg



View of the damaged slope by foot traffic.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---